

LTB01025

TECHNICAL BULLETIN

09 DEC 2016



DRIVE & BEYOND

© Jaguar Land Rover Limited

All rights reserved.

INFORMATION

SECTION:

501-00

SUBJECT/CONCERN:

Underbody Splash Heat Shield Cracking

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Discovery Sport (LC)	2015 Onwards	501001 Onwards	Halewood

MARKETS:

All

CONDITION SUMMARY:

SITUATION:

The Customer may express a concern where a scraping or wind noise can be heard from the underside of the vehicle. The Customer may also report something is hanging down from the underside of the vehicle.

CAUSE:

The splash heat shield is manufactured away from the required specification. **Suggested Customer Concern Code AV4.**

ACTION:

Should a Customer express a concern, follow the service instruction below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY
LR093615	Splash Shield - LH	1
LR093614	Splash Shield - RH	1

WARRANTY:

NOTE:

DDW/WASP requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to JLR claims submission system to obtain the latest repair time.
- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Center Weather Shields - Renew	76.10.89.01	0.3	1	LR061103/LR074799


NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:


1 **WARNING:**
Make sure to support the vehicle with axle stands.

Raise and support the vehicle.

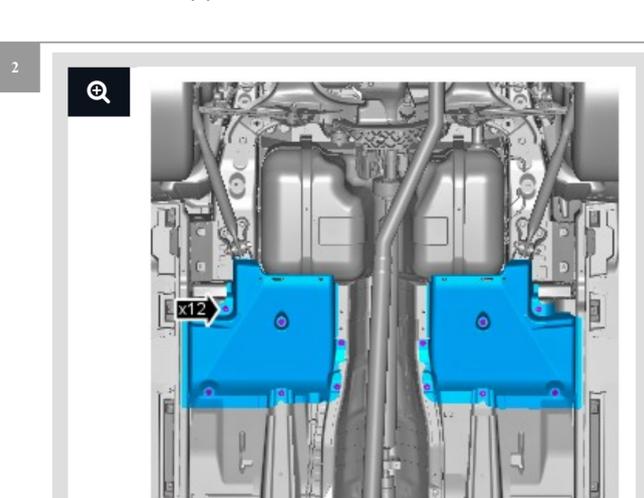

Remove the splash shields.

3 **NOTE:**
Torque 5 Nm

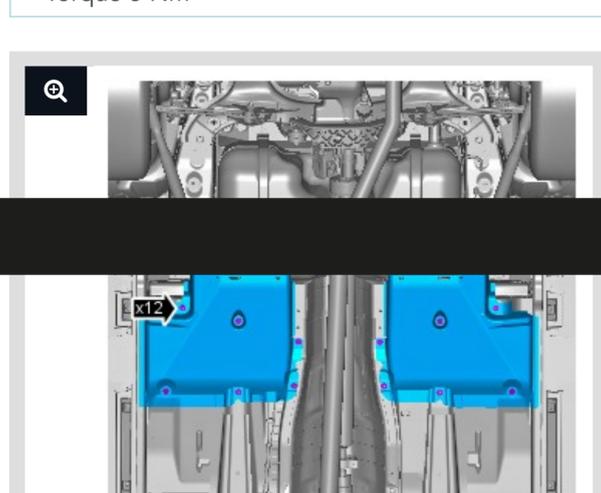

Install the new splash shields.

4 Lower the vehicle.